



150 Dodd Street SE
Marietta, GA. 30060

Phone: 770-973-6251
Fax: 678-401-3854

Email: info@mgs4u.com
Website: www.mgs4u.com




Installation Guide

[UHF female, Crimp-On, Cable End Connector for RG-11, RG-213, RG-213/U, RG-393, RG-393/U, RG-8, RG-8/U, RG-8A, RG-83, LMR-400, LMR-400 Ultraflex, Belden 7810A, Belden 8216, Belden 83269, Belden 83284, Belden 84316, and other 0.390 and 0.405 Inch OD Coax.](#)

We will begin by installing the UHF female crimp-on connector on a piece of coax. This process is the same for all the types of coaxial cable that fit this UHF crimp-on connector. These connectors fit on a wide range of coax types, including: RG-11, RG-213, RG-213/U, RG-393, RG-393/U, RG-8, RG-8/U, RG-8A, RG-83, LMR-400, LMR-400 Ultraflex, Belden 7810A, Belden 8216, Belden 83269, Belden 83284, Belden 84316, and other 0.39 and 0.405 Inch OD Coax.

Identify all connector parts (3 Parts):


Each connector consists of one body assembly (jack), one center pin, and one rear ferrule (crimp sleeve),

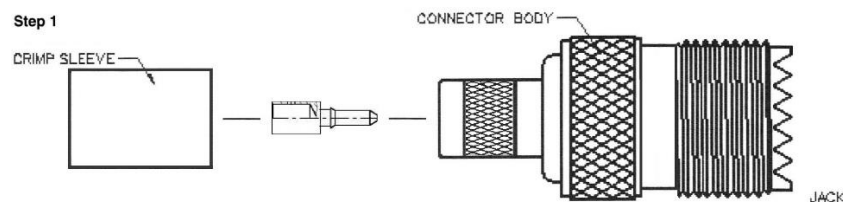

Coax Stripping:


First cut your coaxial cable to the desired length and then strip the black jacket back approximately 14.7mm (0.58"). When the jacket is stripped cut the braid/foil back 5.7mm (0.22") from the fresh cut end. Finally, cut back the dielectric 4mm (0.16") from the fresh end down to the center conductor. The braid needs to be cut back further than the dielectric to insure that none of the braid or foil is touching the center conductor which could cause a short.

Once the cable is prepped, **make sure to put the ferrule (crimp sleeve) of the connector on the coaxial cable BEFORE you proceed.**

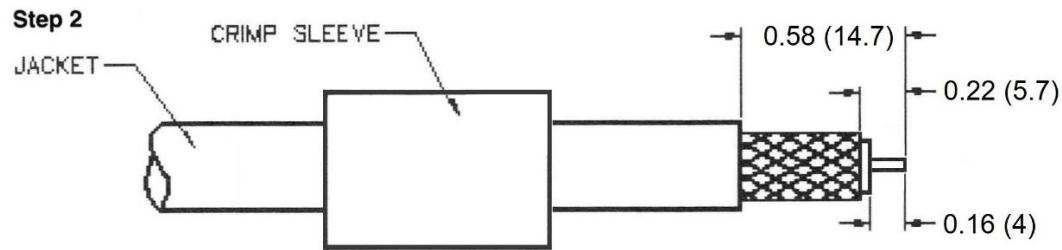

Install Pin:

Fold back the braid and place the center pin onto the center conductor. There is a solder hole on the side of the pin for installing with a small amount of solder OR you can crimp the center pin at the base of the dielectric.

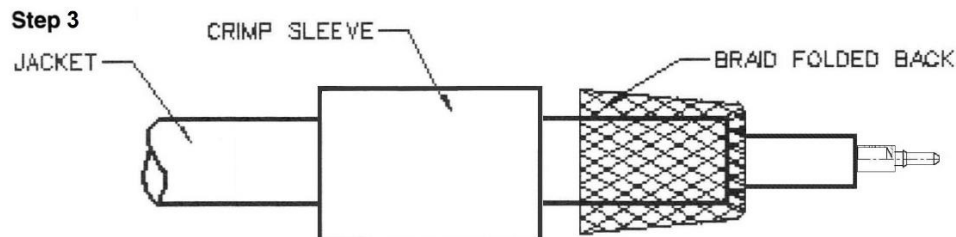

Crimping and Soldering Install:

Soldering Guide (preferred):

This soldering guide is for soldering Max-Gain Systems, Inc. UHF crimp-on connectors. These are approximate measurements for our UHF crimp-on connectors, which adhere to industry standards for this type connector. If you choose to use this guide for connectors sold by others who do NOT adhere to these standards, the measurements could be off and result in a poor installation.


Start by rotating the center pin so that the solder hole is facing up. Apply heat to the center pin by placing your soldering iron underneath the pin. Before proceeding, allow sufficient time for the soldering iron tip to reach full operating temperature and clean the tip of the iron by wiping it with a damp sponge. Now apply the solder to the hole that should be facing up. The heat rises and heats up the pin faster than positioning the iron above the pin. When the pin is heated the solder will start to flow into the pin. It only takes a very little bit of solder to make a good connection.

Crimping Guide:

The center pin is crimpable by using the 0.128" hex die from your 7505-DIE-400 ratcheting crimper die to crimp the center pin at the point where it is closest to the dielectric. This crimp die is available by itself or as a kit with a ratcheting crimp handle.


DIE Only	Die and Tool Kit
P/N: 7505-DIE-400	P/N: 7505-HANDLE-400
	

Now we begin by placing the body of the connector onto the end of the coax. Be sure the center pin seats all the way inside the body of the connector. There is a receptacle inside the connector for this pin to be fully seated. The braid should be folded back forward over the knurled section of the connector body. The braid needs to be on the outside of the connector and not tucked under it. This could lead to a short.

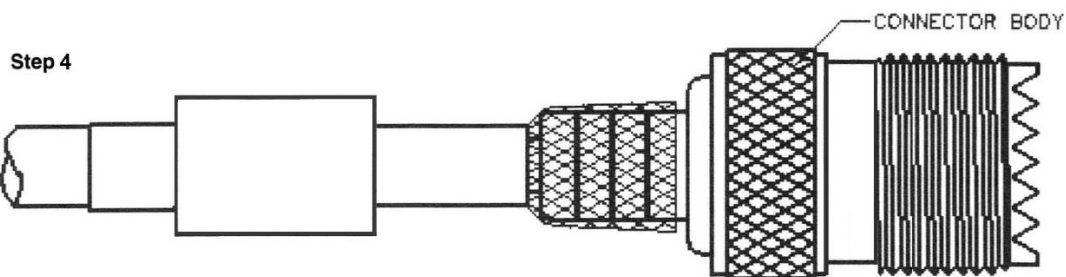

Crimping The Ferrule:

Slide the ferrule (placed on the coax at the beginning of Step 2) over the braid and completely up against the connector body. Using the 0.429 hex of the 7505-DIE-400 installed into the 7505-HANDLE ratcheting crimp handle, crimp the ferrule at the location shown in the picture below (on the ferrule, but right up against the main body of the connector).

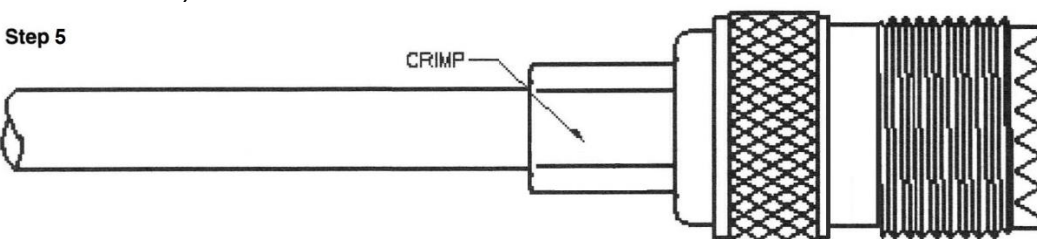

Final Testing:

When this is completed, as a final test, you should always check resistance from the center pin to the body with an ohmmeter in a low resistance scale. After verifying that there are no braid – to – center pin shorts on the other end of the coaxial cable, you should see infinite resistance (open). This completes your UHF female crimp-on connector installation, and the connector is ready for use!